
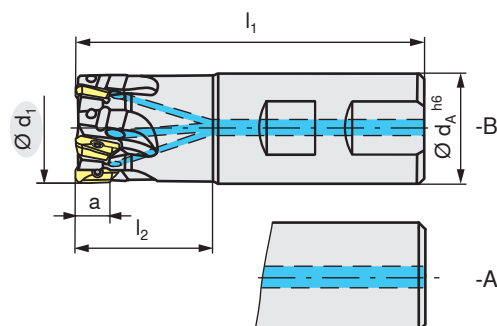


MaxiMill 211 system

C211-07

B116

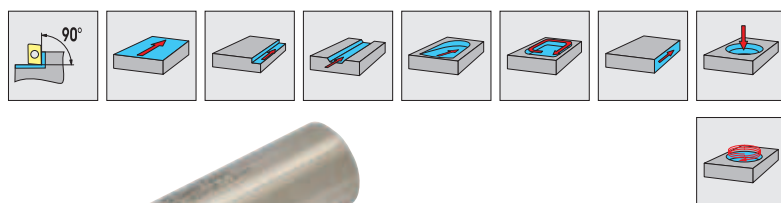

d ₁ [mm]	Type, description	l ₁ [mm]	l ₂ [mm]	d _A [mm]	a [mm]	z	n _{max} [min ⁻¹]	[Nm]		
10	C211.10.R.01-07-A-20	61	20	10	6	1	72000	1	XD.. 07..	E01
12	C211.12.R.02-07-A-20	66.5	20	12	6	2	66600	1	XD.. 07..	E01
16	C211.16.R.03-07-A-32-165	165	32	16	6	3	17760	1	XD.. 07..	E01
16	C211.16.R.04-07-A-25	74.5	25	16	6	4	50400	1	XD.. 07..	E01
16	C211.16.R.04-07-B-25	74.5	25	16	6	4	50400	1	XD.. 07..	E01
20	C211.20.R.04-07-A-40-200	200	40	20	6	4	12600	1	XD.. 07..	E01
20	C211.20.R.05-07-A-25	77	25	20	6	5	44280	1	XD.. 07..	E01
20	C211.20.R.05-07-B-25	77	25	20	6	5	44280	1	XD.. 07..	E01
25	C211.25.R.05-07-A20-50-225	225	50	20	6	5	11280	1	XD.. 07..	E01
25	C211.25.R.06-07-A20-32	84	32	20	6	6	39840	1	XD.. 07..	E01
25	C211.25.R.06-07-B20-32	84	32	20	6	6	39840	1	XD.. 07..	E01
32	C211.32.R.08-07-A25-40	98	40	25	6	8	36240	1	XD.. 07..	E01
32	C211.32.R.08-07-B25-40	98	40	25	6	8	36240	1	XD.. 07..	E01

			
E01	11450028	11450898	8095011700

