
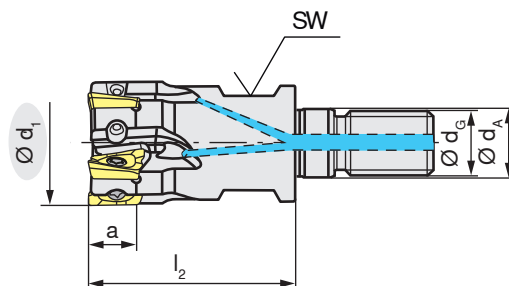


MaxiMill 211 system

G211-07/-11/-15

B120



d ₁ [mm]	Type, description	l ₂ [mm]	d _G [mm]	d _A [mm]	a [mm]	z	n _{max} [min ⁻¹]	[Nm]		
16	G211.16.R.04-07	27	8	8.5	6	4	50400	1	XD.. 07..	E01
20	G211.20.R.05-07	33	10	10.5	6	5	44280	1	XD.. 07..	E01
25	G211.25.R.06-07	35	12	12.5	6	6	39480	1	XD.. 07..	E01
32	G211.32.R.08-07	35	16	17.0	6	8	36240	1	XD.. 07..	E01
16	G211.16.R.02-11	27	8	8.5	10	2	42000	1.6	XD.. 11..	E02
20	G211.20.R.02-11	33	10	10.5	10	2	36900	1.6	XD.. 11..	E02
20	G211.20.R.03-11	33	10	10.5	10	3	36900	1.6	XD.. 11..	E02
25	G211.25.R.03-11	35	12	12.5	10	3	33200	1.6	XD.. 11..	E02
25	G211.25.R.04-11	35	12	12.5	10	4	33200	1.6	XD.. 11..	E02
32	G211.32.R.04-11	35	16	17.0	10	4	30200	1.6	XD.. 11..	E02
32	G211.32.R.05-11	35	16	17.0	10	5	30200	1.6	XD.. 11..	E02
40	G211.40.R.06-11	35	16	17.0	10	6	27700	1.6	XD.. 11..	E03
25	G211.25.R.02-15	35	12	12.5	14	2	26560	3.2	XD.. 15..	E04
32	G211.32.R.03-15	35	16	17.0	14	3	30200	3.2	XD.. 15..	E04
40	G211.40.R.04-15	35	16	17.0	14	4	27700	3.2	XD.. 15..	E04

			
E01	11450028	11450898	8095011700
E02	11114238	11254598	8095003900
E03	11114242	11254598	8095003900
E04	11450042	11450867	8095012000



B276