
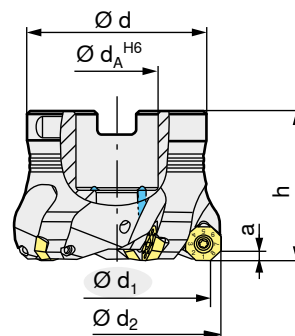


Система MaxiMill 274

A274 OF..



d_1 [mm]	Тип, обозначение	d_2 [mm]	h [mm]	d [mm]	d_A [mm]	a [mm]	z	n_{max} [МИН ⁻¹]			
32	A274.32.R.05-09	37,7	40	38	16	2,5	5	32.200	1,6	OF.. 0403..	E01
40	A274.40.R.04-09	45,7	40	38	16	2,5	4	28.400	1,6	OF.. 0403..	E01
40	A274.40.R.06-09	45,7	40	38	16	2,5	6	28.400	1,6	OF.. 0403..	E01
50	A274.50.R.05-09	55,7	40	48	22	2,5	5	25.200	1,6	OF.. 0403..	E02
50	A274.50.R.07-09	55,7	40	48	22	2,5	7	25.200	1,6	OF.. 0403..	E02
63	A274.63.R.06-09	68,7	40	48	22	2,5	6	22.300	1,6	OF.. 0403..	E02
63	A274.63.R.09-09	68,7	40	48	22	2,5	9	22.300	1,6	OF.. 0403..	E02
80	A274.80.R.07-09	85,7	50	58	27	2,5	7	19.600	1,6	OF.. 0403..	E02
80	A274.80.R.11-09	85,7	50	58	27	2,5	11	19.600	1,6	OF.. 0403..	E02
100	A274.100.R.09-09	105,7	50	78	32	2,5	9	17.500	1,6	OF.. 0403..	E02
100	A274.100.R.13-09	105,7	50	78	32	2,5	13	17.500	1,6	OF.. 0403..	E02
125	A274.125.R.12-09	130,7	63	88	40	2,5	12	15.600	1,6	OF.. 0403..	E02
40	A274.40.R.03-12	48	40	38	16	3	3	21.600	3,2	OF.. 0504..	E03
40	A274.40.R.04-12	48	40	38	16	3	4	21.600	3,2	OF.. 0504..	E03
50	A274.50.R.04-12	58,1	40	43	22	3	4	19.100	3,2	OF.. 0504..	E03
50	A274.50.R.05-12	58,1	40	43	22	3	5	19.100	3,2	OF.. 0504..	E03
63	A274.63.R.05-12	71,1	40	48	22	3	5	16.800	3,2	OF.. 0504..	E03
63	A274.63.R.06-12	71,1	40	48	22	3	6	16.800	3,2	OF.. 0504..	E03
80	A274.80.R.06-12	88	50	58	27	3	6	14.800	3,2	OF.. 0504..	E03
80	A274.80.R.08-12	88	50	58	27	3	8	14.800	3,2	OF.. 0504..	E03
100	A274.100.R.08-12	108	50	78	32	3	8	13.100	3,2	OF.. 0504..	E03
100	A274.100.R.10-12	108	50	78	32	3	10	13.100	3,2	OF.. 0504..	E03
125	A274.125.R.09-12	133	63	88	40	3	9	11.700	3,2	OF.. 0504..	E03
125	A274.125.R.12-12	133	63	88	40	3	12	11.700	3,2	OF.. 0504..	E03
160	A274.160.R.11-12	167,9	63	98	40	3	11	10.300	3,2	OF.. 0504..	E03
160	A274.160.R.14-12	167,9	63	98	40	3	14	10.300	3,2	OF.. 0504..	E03

E01	11036880	11513168	11254598	8095003900	4425
E02		11513168	11254598	8095003900	
E03		11803957	11450867	8095012000	



B276