
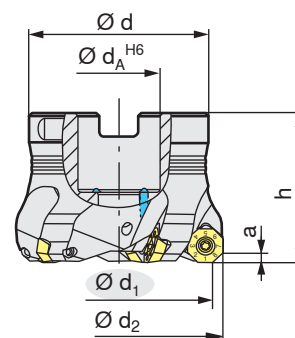


MaxiMill 274 system

A274 OF..

B34



d ₁ [mm]	Type, description	d ₂ [mm]	h [mm]	d [mm]	d _A [mm]	a [mm]	z	n _{max} [min ⁻¹]	[Nm]		
32	A274.32.R.05-09	37.7	40	38	16	2.5	5	32200	1.6	OF.. 0403..	E01
40	A274.40.R.04-09	45.7	40	38	16	2.5	4	28400	1.6	OF.. 0403..	E01
40	A274.40.R.06-09	45.7	40	38	16	2.5	6	28400	1.6	OF.. 0403..	E01
50	A274.50.R.05-09	55.7	40	48	22	2.5	5	25200	1.6	OF.. 0403..	E02
50	A274.50.R.07-09	55.7	40	48	22	2.5	7	25200	1.6	OF.. 0403..	E02
63	A274.63.R.06-09	68.7	40	48	22	2.5	6	22300	1.6	OF.. 0403..	E02
63	A274.63.R.09-09	68.7	40	48	22	2.5	9	22300	1.6	OF.. 0403..	E02
80	A274.80.R.07-09	85.7	50	58	27	2.5	7	19600	1.6	OF.. 0403..	E02
80	A274.80.R.11-09	85.7	50	58	27	2.5	11	19600	1.6	OF.. 0403..	E02
100	A274.100.R.09-09	105.7	50	78	32	2.5	9	17500	1.6	OF.. 0403..	E02
100	A274.100.R.13-09	105.7	50	78	32	2.5	13	17500	1.6	OF.. 0403..	E02
125	A274.125.R.12-09	130.7	63	88	40	2.5	12	15600	1.6	OF.. 0403..	E02
40	A274.40.R.03-12	48	40	38	16	3	3	21600	3.2	OF.. 0504..	E03
40	A274.40.R.04-12	48	40	38	16	3	4	21600	3.2	OF.. 0504..	E03
50	A274.50.R.04-12	58.1	40	43	22	3	4	19100	3.2	OF.. 0504..	E03
50	A274.50.R.05-12	58.1	40	43	22	3	5	19100	3.2	OF.. 0504..	E03
63	A274.63.R.05-12	71.1	40	48	22	3	5	16800	3.2	OF.. 0504..	E03
63	A274.63.R.06-12	71.1	40	48	22	3	6	16800	3.2	OF.. 0504..	E03
80	A274.80.R.06-12	88	50	58	27	3	6	14800	3.2	OF.. 0504..	E03
80	A274.80.R.08-12	88	50	58	27	3	8	14800	3.2	OF.. 0504..	E03
100	A274.100.R.08-12	108	50	78	32	3	8	13100	3.2	OF.. 0504..	E03
100	A274.100.R.10-12	108	50	78	32	3	10	13100	3.2	OF.. 0504..	E03
125	A274.125.R.09-12	133	63	88	40	3	9	11700	3.2	OF.. 0504..	E03
125	A274.125.R.12-12	133	63	88	40	3	12	11700	3.2	OF.. 0504..	E03
160	A274.160.R.11-12	167.9	63	98	40	3	11	10300	3.2	OF.. 0504..	E03
160	A274.160.R.14-12	167.9	63	98	40	3	14	10300	3.2	OF.. 0504..	E03

E01	11036880	11513168	11254598	8095003900	4425
E02		11513168	11254598	8095003900	
E03		11803957	11450867	8095012000	



B276